

TITLE: Solara ion Reminder Note

Category: Solara ion

Document Number: 08 - 7

Supplied by: Gerber Service

Last Modified: October 10, 2008

Summary: This weekly Solara ion Reminder Note contains one item:

- Luer fittings need to be checked at install and UV shield update

Issue: Luer fittings need to be checked at install and UV shield update

Just a quick reminder to all FSE's. It is critically important that all Luer fittings are checked at install and at UV shield update. Although production has long begun doing a double check of Luer fittings, at least one unit was shipped without being properly connected.

Here is the procedure as it appears on Service Note 2008 - ion - 002. Take a moment at each opportunity to check Luer fittings.

Ink Connections

The ink system is sensitive to poor connections. It is possible in transit prior to delivery that some ink connections could vibrate loose.

Poor connections can result in loss of vacuum, nozzle misfire, ink dripping from the heads as well as obvious ink leaks. In order to eliminate potential leaks it is essential you check all the connections in the ink tubes at installation.

Please check all the Luer fittings in the ink system. Ensure there is no inherent tension within the ink lines. (Twist the connections before assembly, so that their natural tendency is to tighten). There are connections in the following areas:

- ◆ The back of the ink drawer assembly (1 either side of each one way valve).
- ◆ At the top of the gantry between the two separate cable track assemblies.
- ◆ At the top of the carriage.